




NomadStamp

Vehicle record — YF18 KXN

Vehicle

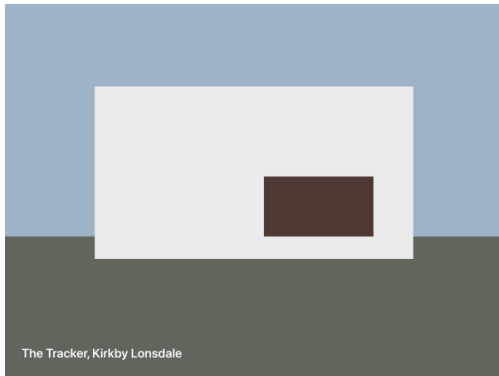

Registration	YF18 KXN
Make and model	Fiat Ducato 2.3 MultiJet — Auto-Trail Tracker EKS
Fuel	Diesel
First registered	15 March 2018
VIN	ZFA25000002 A47821
MTPLM	3,500 kg
MIRO	3,010 kg
Payload	490 kg
Test regime	MOT Class 4
Notes	Bought new from Marquis Preston, March 2018. Two belted travel seats. Solar and lithium fitted 2021.

On file, year by year

	2018	2019	2020	2021	2022	2023	2024	2025	2026
Base vehicle									
Service		•	•	•	•	•	•	•	•
Pinned work		•	•	•	•	•	•	•	•
MOT				•	•	•	•	•	•
Habitation									
Habitation check	•	•	•	•	•	•	•	•	
Damp survey	•	•	•	•	•	•	•	•	•
Gas safety record				•		•		•	

A mark shows a document recorded for that year. A blank means nothing was entered for it, which is a statement about this logbook and not about the vehicle.

Service history

Base vehicle



YF18 KXN — vehicle record

Date	Work done	Odometer	Cost
22 Apr 2026	Full service. Oil and filter, air, fuel and pollen filters, front pads replaced, cab tilt mechanism greased, road test. Fenwick Commercials, Chorley · FC-2604-1013 · Battery noted as weakening — not replaced.	43,910	£428.00
16 Apr 2025	Full service. Oil and filter, fuel and pollen filters, EGR cleaned, brake inspection, road test. Fenwick Commercials, Chorley · FC-2504-884	37,720	£394.00
24 Apr 2024	Full service. Oil and filter, air and pollen filters, brake fluid renewed, rear pads and discs replaced, road test. Fenwick Commercials, Chorley · FC-2404-702 · New tyres all round fitted May 2023, hence tread.	31,450	£362.00
24 May 2023	Four Michelin Agilis CrossClimate supplied and fitted, valves and balancing. Kwik Fit Leyland · KF-LEY-88213	26,300	£784.00
19 Apr 2023	Full service. Oil and filter, pollen filter, brake inspection, cambelt and water pump renewed (time-led, 5 years), road test. Fenwick Commercials, Chorley · FC-2304-511 · Cambelt done on age not mileage — 5 years, 25k miles.	25,880	£387.50
27 Apr 2022	Full service. Oil and filter, air, fuel and pollen filters, front pads replaced, DPF forced regeneration, road test. Fenwick Commercials, Chorley · FC-2204-338 · Moved to Fenwick — closer and does motorhomes.	19,640	£416.00
14 Apr 2021	Full service plus brake fluid change. Oil and filter, pollen filter, brake fluid renewed, road test. Marquis Preston · MQ-141773	13,110	£349.00
21 Apr 2020	Full service. Oil and filter, air filter, fuel filter, pollen filter, brake fluid test, road test. Marquis Preston · MQ-129041 · Delayed from March — workshop shut.	9,980	£312.00
9 Apr 2019	First service. Engine oil and filter, pollen filter, all levels, brake inspection, road test. Marquis Preston · MQ-114882	5,240	£284.50
Invoices			
Date	Work done	Odometer	Cost
30 Jun 2026	Windscreen chip monitored, no repair carried out. Inspection only. Autoglass · AG-2606-4471	45,100	£0.00
3 Dec 2025	Habitation door lock barrel replaced — key snapped. Ribble Valley Motorhomes · RVM-25-2091	41,880	£112.00



YF18 KXN — vehicle record

19 Aug 2024	Reversing camera and monitor supplied and fitted. Ribble Valley Motorhomes · RVM-24-1502	33,180	£479.00
8 Feb 2024	Thetford cassette toilet seal kit and new blade seal fitted. Ribble Valley Motorhomes · RVM-24-0208	30,390	£84.50
30 Nov 2022	Truma Combi serviced and burner cleaned — booked separately from the habitation check. Ribble Valley Motorhomes · RVM-22-1288	23,910	£126.00
22 Aug 2022	Rear rooflight and surround replaced following branch damage. Ribble Valley Motorhomes · RVM-22-0977	22,480	£185.00
12 Jun 2021	Solar panel, controller and 110Ah lithium leisure battery supplied and fitted. Existing lead-acid removed. Ribble Valley Motorhomes · RVM-21-0611	14,280	£1,895.00
14 Oct 2019	Offside rear light cluster replaced, panel filled and resprayed after the Honfleur bollard. Marquis Preston · MQ-126718	7,910	£420.00

Certificates and dates

Base vehicle

Date	Certificate	Odometer	Cost
16 Mar 2026	MOT — Pass. No defects. Fenwick Commercials, Chorley · MOT-2026-912008 · expires 16 Mar 2027	43,580	
8 Jun 2025	Breakdown cover The Camping and Caravanning Club (RAC) · BD-2025-22906 · expires 8 Jun 2026 · European cover, includes the habitation body over 3.5m.		£189.00
1 Apr 2025	Road tax DVLA · VED-2025 · expires 1 Apr 2026		£345.00
17 Mar 2025	MOT — Pass with advisory: offside rear brake pipe lightly corroded. Fenwick Commercials, Chorley · MOT-2025-884330 · expires 17 Mar 2026	37,400	
15 Mar 2025	Insurance Safeguard Motorhome · POL-2025-778075 · expires 15 Mar 2026		£483.00
8 Jun 2024	Breakdown cover The Camping and Caravanning Club (RAC) · BD-2024-22905 · expires 8 Jun 2025 · European cover, includes the habitation body over 3.5m.		£189.00
1 Apr 2024	Road tax DVLA · VED-2024 · expires 1 Apr 2025		£345.00



YF18 KXN — vehicle record

15 Mar 2024	Insurance Safeguard Motorhome · POL-2024-778072 · expires 15 Mar 2025	£459.00
11 Mar 2024	MOT — Pass. No defects. Fenwick Commercials, Chorley · MOT-2024-856912 · expires 11 Mar 2025	31,120
8 Jun 2023	Breakdown cover The Camping and Caravanning Club (RAC) · BD-2023-22904 · expires 8 Jun 2024 · European cover, includes the habitation body over 3.5m.	£189.00
1 Apr 2023	Road tax DVLA · VED-2023 · expires 1 Apr 2024	£345.00
15 Mar 2023	Insurance Safeguard Motorhome · POL-2023-778069 · expires 15 Mar 2024	£435.00
13 Mar 2023	MOT — Pass with advisories: all four tyres worn close to the legal limit; corrosion to rear suspension mounting, not excessive. Fenwick Commercials, Chorley · MOT-2023-829063 · expires 13 Mar 2024	25,540
8 Jun 2022	Breakdown cover The Camping and Caravanning Club (RAC) · BD-2022-22903 · expires 8 Jun 2023 · European cover, includes the habitation body over 3.5m.	£189.00
15 Mar 2022	Insurance Safeguard Motorhome · POL-2022-778066 · expires 15 Mar 2023 · Moved insurer — Comfort would not cover the lithium install.	£411.00
14 Mar 2022	MOT — Pass with advisories: nearside front tyre worn close to the legal limit; slight play in offside track rod end. Fenwick Commercials, Chorley · MOT-2022-801447 · expires 14 Mar 2023	19,310
15 Mar 2021	Insurance Comfort Insurance · POL-2021-778063 · expires 15 Mar 2022	£387.00
12 Mar 2021	MOT — Pass. No defects. Fenwick Commercials, Chorley · MOT-2021-778210 · expires 12 Mar 2022	12,880
15 Mar 2020	Insurance Comfort Insurance · POL-2020-778060 · expires 15 Mar 2021	£363.00
15 Mar 2019	Insurance Comfort Insurance · POL-2019-778057 · expires 15 Mar 2020	£339.00
15 Mar 2018	Insurance Comfort Insurance · POL-2018-778054 · expires 15 Mar 2019	£315.00



YF18 KXN — vehicle record

Habitation

Date	Certificate	Odometer	Cost
27 Sep 2025	Habitation check — Pass. Rear nearside corner continuing to fall. Washroom seal renewed at owner's request. Habitation service. Gas soundness and appliance service, electrical test, water sanitise, damp survey, ventilation and fire safety check. · Ribble Valley Motorhomes · RVM-25-1944 · expires 27 Sep 2026	40,680	£310.00
18 Sep 2025	Gas safety record — All appliances tested and passed. Gas Safe registration 512883. Ribble Valley Motorhomes · GSR-2025-6435 · expires 18 Sep 2026		
21 Sep 2024	Habitation check — Pass. Rear nearside corner has fallen following last year's reseal. Washroom reading unchanged. Habitation service. Gas soundness and appliance service, electrical test, water sanitise, damp survey, ventilation and fire safety check. · Ribble Valley Motorhomes · RVM-24-1677 · expires 21 Sep 2025	34,510	£295.00
30 Sep 2023	Habitation check — Pass. Rear panel joint stripped and resealed during this visit. Readings taken before the work; recheck advised next year. Habitation service plus rear panel joint reseal. Gas soundness and appliance service (regulator adjusted to 30mbar), electrical test, water sanitise, damp survey, rear panel joint stripped and resealed, ventilation and fire safety check. · Ribble Valley Motorhomes · RVM-23-1408 · expires 30 Sep 2024	28,600	£442.00
18 Sep 2023	Gas safety record — All appliances tested and passed. Gas Safe registration 512883. Ribble Valley Motorhomes · GSR-2023-6433 · expires 18 Sep 2024		
24 Sep 2022	Habitation check — Pass. Rear nearside corner continuing to rise. Recommend investigation of the rear panel joint. Habitation service. Gas soundness and appliance service, electrical test, water sanitise, damp survey, ventilation and fire safety check. · Ribble Valley Motorhomes · RVM-22-1140 · expires 24 Sep 2023	22,750	£279.00
18 Sep 2021	Habitation check — Pass. Rear seals renewed by owner since last visit; readings unchanged so far. Solar installation checked and found satisfactory. Habitation service. Gas soundness and appliance service, electrical test including new solar install check, water sanitise, damp survey, ventilation and fire safety check. · Ribble Valley Motorhomes · RVM-21-0884 · expires 18 Sep 2022	16,240	£264.00



YF18 KXN — vehicle record

18 Sep 2021	Gas safety record — All appliances tested and passed. Gas Safe registration 512883. Ribble Valley Motorhomes · GSR-2021-6431 · expires 18 Sep 2022		
3 Oct 2020	Habitation check — Pass. Rear nearside corner reading has risen. Rear light cluster seal advised. Habitation service. Gas soundness and appliance service, electrical test, water sanitise, damp survey, ventilation and fire safety check. · Marquis Preston · MQ-133017 · expires 3 Oct 2021	11,320	£235.00
26 Sep 2019	Habitation check — Pass. Minor moisture noted at rear nearside lower corner, below the reporting threshold last year and now recorded. Advised monitoring. Habitation service. Gas soundness and appliance service, 230V and 12V test, water system sanitise, damp survey, ventilation and fire safety check. · Marquis Preston · MQ-124902 · expires 26 Sep 2020	7,480	£220.00
20 Sep 2018	Habitation check — Pass. No defects found. All appliances operating within manufacturer's specification. First habitation service. Gas soundness and appliance service, 230V and 12V test, water system flush and sanitise, damp survey, ventilation check, fire safety check. · Marquis Preston · MQ-118330 · expires 20 Sep 2019	2,610	£215.00
Other			
Date	Certificate	Odometer	Cost
15 Mar 2018	Water ingress warranty — Ten-year water ingress warranty, conditional on an annual habitation service by an approved workshop. Auto-Trail · AT-WIW-118837 · expires 15 Mar 2028		

Inspection sheets

Habitation

27 September 2025 · Habitation check · Ribble Valley Motorhomes

Gas

Gas soundness test (2 minutes at working pressure)	Pass — no drop	Working pressure at test point	30 mbar
Regulator condition and date	Checked — within date	Flexible hose condition and date	Checked — no perishing
Hob and grill — flame picture and flame failure — Hob and grill	Checked and operating correctly	Space heater — combustion and flue seal — Heating and hot water	Checked and operating correctly



YF18 KXN — vehicle record

Fridge on gas — flame
and flue — Fridge

Checked and
operating
correctly

Electrical, 230V

Earth bond resistance

0.09 Ω

RCD trip time at rated
current

24 ms

Polarity and continuity
at all sockets

Checked — correct

Electrical, 12V

Leisure battery
condition and charge —
Leisure battery

Checked —
holding charge

Charger and solar
controller operation —
Solar controller

Checked and
operating
correctly

Water

Fresh system flushed
and sanitised

Carried out

Pump operation and
pressure cut-out —
Water pump

Checked and
operating
correctly

Waste system and
drain-down valves

Checked — free-
flowing

Ventilation

Fixed low- and high-
level ventilation,
unobstructed

Checked — clear

Body and seals

External seams, seals
and roof fittings

Inspected

Fire safety

Extinguisher, blanket,
smoke and CO alarms
— Carbon monoxide
alarm

Checked — all in
date and operating

21 September 2024 · Habitation check · Ribble Valley Motorhomes

Gas

Gas soundness test (2
minutes at working
pressure)

Pass — no drop

Working pressure at
test point

30 mbar

Regulator condition and
date

Checked — within
date

Flexible hose condition
and date

Checked — no
perishing

Hob and grill — flame
picture and flame
failure — Hob and grill

Checked and
operating
correctly

Space heater —
combustion and flue
seal — Heating and hot
water

Checked and
operating
correctly

Fridge on gas — flame
and flue — Fridge

Checked and
operating
correctly

Electrical, 230V

Earth bond resistance

0.1 Ω

RCD trip time at rated
current

25 ms



YF18 KXN — vehicle record

Polarity and continuity at all sockets Checked — correct

Electrical, 12V

Leisure battery condition and charge — Leisure battery	Checked — holding charge	Charger and solar controller operation — Solar controller	Checked and operating correctly
--	--------------------------	---	---------------------------------

Water

Fresh system flushed and sanitised	Carried out	Pump operation and pressure cut-out — Water pump	Checked and operating correctly
------------------------------------	-------------	--	---------------------------------

Waste system and drain-down valves	Checked — free-flowing
------------------------------------	------------------------

Ventilation

Fixed low- and high-level ventilation, unobstructed	Checked — clear
---	-----------------

Body and seals

External seams, seals and roof fittings	Inspected
---	-----------

Fire safety

Extinguisher, blanket, smoke and CO alarms — Carbon monoxide alarm	Checked — all in date and operating
--	-------------------------------------

30 September 2023 · Habitation check · Ribble Valley Motorhomes

Gas

Gas soundness test (2 minutes at working pressure)	Pass — no drop	Working pressure at test point	30 mbar
--	----------------	--------------------------------	---------

Regulator condition and date	Checked — within date	Flexible hose condition and date	Checked — no perishing
------------------------------	-----------------------	----------------------------------	------------------------

Hob and grill — flame picture and flame failure — Hob and grill	Checked and operating correctly	Space heater — combustion and flue seal — Heating and hot water	Checked and operating correctly
---	---------------------------------	---	---------------------------------

Fridge on gas — flame and flue — Fridge	Checked and operating correctly
---	---------------------------------

Electrical, 230V

Earth bond resistance	0.11 Ω	RCD trip time at rated current	26 ms
-----------------------	--------	--------------------------------	-------

Polarity and continuity at all sockets	Checked — correct
--	-------------------

Electrical, 12V

Leisure battery condition and charge — Leisure battery	Checked — holding charge	Charger and solar controller operation — Solar controller	Checked and operating correctly
--	--------------------------	---	---------------------------------



YF18 KXN — vehicle record

Water

Fresh system flushed and sanitised	Carried out	Pump operation and pressure cut-out — Water pump	Checked and operating correctly
------------------------------------	-------------	--	---------------------------------

Waste system and drain-down valves	Checked — free-flowing
------------------------------------	------------------------

Ventilation

Fixed low- and high-level ventilation, unobstructed	Checked — clear
---	-----------------

Body and seals

External seams, seals and roof fittings	Inspected
---	-----------

Fire safety

Extinguisher, blanket, smoke and CO alarms — Carbon monoxide alarm	Checked — all in date and operating
--	-------------------------------------

24 September 2022 · Habitation check · Ribble Valley Motorhomes

Gas

Gas soundness test (2 minutes at working pressure)	Pass — no drop	Working pressure at test point	29 mbar
--	----------------	--------------------------------	---------

Regulator condition and date	Checked — within date	Flexible hose condition and date	Checked — no perishing
------------------------------	-----------------------	----------------------------------	------------------------

Hob and grill — flame picture and flame failure — Hob and grill	Checked and operating correctly	Space heater — combustion and flue seal — Heating and hot water	Checked and operating correctly
---	---------------------------------	---	---------------------------------

Fridge on gas — flame and flue — Fridge	Checked and operating correctly
---	---------------------------------

Electrical, 230V

Earth bond resistance	0.11 Ω	RCD trip time at rated current	27 ms
-----------------------	---------------	--------------------------------	-------

Polarity and continuity at all sockets	Checked — correct
--	-------------------

Electrical, 12V

Leisure battery condition and charge — Leisure battery	Checked — holding charge	Charger and solar controller operation — Solar controller	Checked and operating correctly
--	--------------------------	---	---------------------------------

Water

Fresh system flushed and sanitised	Carried out	Pump operation and pressure cut-out — Water pump	Checked and operating correctly
------------------------------------	-------------	--	---------------------------------

Waste system and drain-down valves	Checked — free-flowing
------------------------------------	------------------------



YF18 KXN — vehicle record

Ventilation

Fixed low- and high-level ventilation, unobstructed

Checked — clear

Body and seals

External seams, seals and roof fittings

Inspected

Fire safety

Extinguisher, blanket, smoke and CO alarms — Carbon monoxide alarm

Checked — all in date and operating

18 September 2021 · Habitation check · Ribble Valley Motorhomes

Gas

Gas soundness test (2 minutes at working pressure)	Pass — no drop	Working pressure at test point	29.5 mbar
Regulator condition and date	Checked — within date	Flexible hose condition and date	Checked — no perishing
Hob and grill — flame picture and flame failure — Hob and grill	Checked and operating correctly	Space heater — combustion and flue seal — Heating and hot water	Checked and operating correctly
Fridge on gas — flame and flue — Fridge	Checked and operating correctly		

Electrical, 230V

Earth bond resistance	0.1 Ω	RCD trip time at rated current	25 ms
Polarity and continuity at all sockets	Checked — correct		

Electrical, 12V

Leisure battery condition and charge — Leisure battery	Checked — holding charge	Charger and solar controller operation — Solar controller	Checked and operating correctly
--	--------------------------	---	---------------------------------

Water

Fresh system flushed and sanitised	Carried out	Pump operation and pressure cut-out — Water pump	Checked and operating correctly
Waste system and drain-down valves	Checked — free-flowing		

Ventilation

Fixed low- and high-level ventilation, unobstructed

Checked — clear

Body and seals

External seams, seals and roof fittings

Inspected



YF18 KXN — vehicle record

Fire safety

Extinguisher, blanket,
smoke and CO alarms
— Carbon monoxide
alarm

Checked — all in
date and operating

3 October 2020 · Habitation check · Marquis Preston

Gas

Gas soundness test (2 minutes at working pressure)	Pass — no drop	Working pressure at test point	29.5 mbar
Regulator condition and date	Checked — within date	Flexible hose condition and date	Checked — no perishing
Hob and grill — flame picture and flame failure — Hob and grill	Checked and operating correctly	Space heater — combustion and flue seal — Heating and hot water	Checked and operating correctly
Fridge on gas — flame and flue — Fridge	Checked and operating correctly		

Electrical, 230V

Earth bond resistance	0.09 Ω	RCD trip time at rated current	26 ms
Polarity and continuity at all sockets	Checked — correct		

Electrical, 12V

Leisure battery condition and charge — Leisure battery	Checked — holding charge	Charger and solar controller operation — Solar controller	Checked and operating correctly
--	-----------------------------	---	---------------------------------------

Water

Fresh system flushed and sanitised	Carried out	Pump operation and pressure cut-out — Water pump	Checked and operating correctly
Waste system and drain-down valves	Checked — free- flowing		

Ventilation

Fixed low- and high- level ventilation, unobstructed	Checked — clear
--	-----------------

Body and seals

External seams, seals and roof fittings	Inspected
--	-----------

Fire safety

Extinguisher, blanket,
smoke and CO alarms
— Carbon monoxide
alarm

Checked — all in
date and operating



YF18 KXN — vehicle record

26 September 2019 · Habitation check · Marquis Preston

Gas

Gas soundness test (2 minutes at working pressure)	Pass — no drop	Working pressure at test point	30 mbar
Regulator condition and date	Checked — within date	Flexible hose condition and date	Checked — no perishing
Hob and grill — flame picture and flame failure — Hob and grill	Checked and operating correctly	Space heater — combustion and flue seal — Heating and hot water	Checked and operating correctly
Fridge on gas — flame and flue — Fridge	Checked and operating correctly		

Electrical, 230V

Earth bond resistance	0.09 Ω	RCD trip time at rated current	25 ms
Polarity and continuity at all sockets	Checked — correct		

Electrical, 12V

Leisure battery condition and charge — Leisure battery	Checked — holding charge	Charger and solar controller operation — Solar controller	Checked and operating correctly
--	--------------------------	---	---------------------------------

Water

Fresh system flushed and sanitised	Carried out	Pump operation and pressure cut-out — Water pump	Checked and operating correctly
Waste system and drain-down valves	Checked — free-flowing		

Ventilation

Fixed low- and high-level ventilation, unobstructed	Checked — clear
---	-----------------

Body and seals

External seams, seals and roof fittings	Inspected
---	-----------

Fire safety

Extinguisher, blanket, smoke and CO alarms — Carbon monoxide alarm	Checked — all in date and operating
--	-------------------------------------

20 September 2018 · Habitation check · Marquis Preston

Gas

Gas soundness test (2 minutes at working pressure)	Pass — no drop	Working pressure at test point	30 mbar
--	----------------	--------------------------------	---------



YF18 KXN — vehicle record

Regulator condition and date	Checked — within date	Flexible hose condition and date	Checked — no perishing
Hob and grill — flame picture and flame failure — Hob and grill	Checked and operating correctly	Space heater — combustion and flue seal — Heating and hot water	Checked and operating correctly
Fridge on gas — flame and flue — Fridge	Checked and operating correctly		
Electrical, 230V			
Earth bond resistance	0.08 Ω	RCD trip time at rated current	24 ms
Polarity and continuity at all sockets	Checked — correct		
Electrical, 12V			
Leisure battery condition and charge — Leisure battery	Checked — holding charge	Charger and solar controller operation — Solar controller	Checked and operating correctly
Water			
Fresh system flushed and sanitised	Carried out	Pump operation and pressure cut-out — Water pump	Checked and operating correctly
Waste system and drain-down valves	Checked — free-flowing		
Ventilation			
Fixed low- and high-level ventilation, unobstructed	Checked — clear		
Body and seals			
External seams, seals and roof fittings	Inspected		
Fire safety			
Extinguisher, blanket, smoke and CO alarms — Carbon monoxide alarm	Checked — all in date and operating		

Base vehicle

22 April 2026 · Base vehicle service · Fenwick Commercials, Chorley

Engine and fluids

Engine oil and filter	Replaced	Coolant level and strength	Checked — OK to -35°C
Auxiliary drive belt	Checked — no cracking	Cambelt	Checked, not renewed

Brakes

Front pad thickness	12 mm	Rear pad thickness	9.1 mm
Brake fluid moisture content	1.9 %	Handbrake travel	Checked and adjusted



YF18 KXN — vehicle record

Tyres and wheels

Tread depth, front axle	5.8 mm	Tread depth, rear axle	6.9 mm
Wheel nut torque	160 Nm		

Electrical

Starter battery, resting voltage	12.3 V
----------------------------------	--------

Exhaust and emissions

DPF condition and regeneration	Checked — regenerating normally	AdBlue level	Refilled 10L
--------------------------------	---------------------------------	--------------	--------------

16 April 2025 · Base vehicle service · Fenwick Commercials, Chorley

Engine and fluids

Engine oil and filter	Replaced	Coolant level and strength	Checked — OK to -35°C
Auxiliary drive belt	Checked — no cracking	Cambelt	Checked, not renewed

Brakes

Front pad thickness	7.8 mm	Rear pad thickness	10.4 mm
Brake fluid moisture content	1.2 %	Handbrake travel	Checked and adjusted

Tyres and wheels

Tread depth, front axle	6.9 mm	Tread depth, rear axle	7.7 mm
Wheel nut torque	160 Nm		

Electrical

Starter battery, resting voltage	12.4 V
----------------------------------	--------

Exhaust and emissions

DPF condition and regeneration	Checked — regenerating normally	AdBlue level	Topped up
--------------------------------	---------------------------------	--------------	-----------

24 April 2024 · Base vehicle service · Fenwick Commercials, Chorley

Engine and fluids

Engine oil and filter	Replaced	Coolant level and strength	Checked — OK to -35°C
Auxiliary drive belt	Checked — no cracking	Cambelt	Checked, not renewed

Brakes

Front pad thickness	9.2 mm	Rear pad thickness	12 mm
Brake fluid moisture content	0.5 %	Handbrake travel	Checked and adjusted

Tyres and wheels

Tread depth, front axle	7.9 mm	Tread depth, rear axle	8.2 mm
Wheel nut torque	160 Nm		

Electrical



YF18 KXN — vehicle record

Starter battery, resting voltage 12.5 V

Exhaust and emissions

DPF condition and regeneration	Checked — regenerating normally	AdBlue level	Refilled 10L
--------------------------------	---------------------------------	--------------	--------------

19 April 2023 · Base vehicle service · Fenwick Commercials, Chorley

Engine and fluids

Engine oil and filter	Replaced	Coolant level and strength	Checked — OK to -35°C
Auxiliary drive belt	Checked — no cracking	Cambelt	Renewed with water pump

Brakes

Front pad thickness	10.6 mm	Rear pad thickness	7.1 mm
Brake fluid moisture content	1.8 %	Handbrake travel	Checked and adjusted

Tyres and wheels

Tread depth, front axle	4.1 mm	Tread depth, rear axle	5.9 mm
Wheel nut torque	160 Nm		

Electrical

Starter battery, resting voltage 12.6 V

Exhaust and emissions

DPF condition and regeneration	Checked — regenerating normally	AdBlue level	Topped up
--------------------------------	---------------------------------	--------------	-----------

27 April 2022 · Base vehicle service · Fenwick Commercials, Chorley

Engine and fluids

Engine oil and filter	Replaced	Coolant level and strength	Checked — OK to -35°C
Auxiliary drive belt	Checked — no cracking	Cambelt	Checked, not renewed

Brakes

Front pad thickness	12 mm	Rear pad thickness	8.2 mm
Brake fluid moisture content	1.1 %	Handbrake travel	Checked and adjusted

Tyres and wheels

Tread depth, front axle	5.4 mm	Tread depth, rear axle	6.8 mm
Wheel nut torque	160 Nm		

Electrical

Starter battery, resting voltage 12.4 V

Exhaust and emissions



YF18 KXN — vehicle record

DPF condition and regeneration	Forced regeneration carried out	AdBlue level	Refilled 10L
--------------------------------	---------------------------------	--------------	--------------

14 April 2021 · Base vehicle service · Marquis Preston

Engine and fluids

Engine oil and filter	Replaced	Coolant level and strength	Checked — OK to -35°C
Auxiliary drive belt	Checked — no cracking	Cambelt	Checked, not renewed

Brakes

Front pad thickness	8.9 mm	Rear pad thickness	9.1 mm
Brake fluid moisture content	0.4 %	Handbrake travel	Checked and adjusted

Tyres and wheels

Tread depth, front axle	6.6 mm	Tread depth, rear axle	7.4 mm
Wheel nut torque	160 Nm		

Electrical

Starter battery, resting voltage	12.5 V
----------------------------------	--------

Exhaust and emissions

DPF condition and regeneration	Checked — regenerating normally	AdBlue level	Topped up
--------------------------------	---------------------------------	--------------	-----------

21 April 2020 · Base vehicle service · Marquis Preston

Engine and fluids

Engine oil and filter	Replaced	Coolant level and strength	Checked — OK to -35°C
Auxiliary drive belt	Checked — no cracking	Cambelt	Checked, not renewed

Brakes

Front pad thickness	10.1 mm	Rear pad thickness	9.8 mm
Brake fluid moisture content	1.4 %	Handbrake travel	Checked and adjusted

Tyres and wheels

Tread depth, front axle	7.2 mm	Tread depth, rear axle	7.9 mm
Wheel nut torque	160 Nm		

Electrical

Starter battery, resting voltage	12.6 V
----------------------------------	--------

Exhaust and emissions

DPF condition and regeneration	Checked — regenerating normally	AdBlue level	Topped up
--------------------------------	---------------------------------	--------------	-----------



YF18 KXN — vehicle record

9 April 2019 · Base vehicle service · Marquis Preston

Engine and fluids

Engine oil and filter	Replaced	Coolant level and strength	Checked — OK to -35°C
Auxiliary drive belt	Checked — no cracking	Cambelt	Checked, not renewed

Brakes

Front pad thickness	11.8 mm	Rear pad thickness	10.4 mm
Brake fluid moisture content	0.6 %	Handbrake travel	Checked and adjusted

Tyres and wheels

Tread depth, front axle	8.1 mm	Tread depth, rear axle	8.3 mm
Wheel nut torque	160 Nm		

Electrical

Starter battery, resting voltage	12.7 V
----------------------------------	--------

Exhaust and emissions

DPF condition and regeneration	Checked — regenerating normally	AdBlue level	Topped up
--------------------------------	---------------------------------	--------------	-----------

Every line is reproduced as the workshop wrote it. Nothing here has been ranked, scored or assessed, and a line with no entry beside it was left blank on the original.

Tyre register

Fitted	Position and tyre	Odometer	DOT code
15 Mar 2018	Front nearside Continental VanContact 4Season · 225/75 R16 CP 118R · removed 24 May 2023 · Original fitment, replaced at 26,300 miles.	12	3618
24 May 2023	Front nearside Michelin Agilis CrossClimate · 225/75 R16 CP 118R · Full set of four, fitted at Kwik Fit Leyland.	26,300	0523
15 Mar 2018	Front offside Continental VanContact 4Season · 225/75 R16 CP 118R · removed 24 May 2023 · Original fitment, replaced at 26,300 miles.	12	3618
24 May 2023	Front offside Michelin Agilis CrossClimate · 225/75 R16 CP 118R · Full set of four, fitted at Kwik Fit Leyland.	26,300	0523
15 Mar 2018	Rear nearside Continental VanContact 4Season · 225/75 R16 CP 118R · removed 24 May 2023 · Original fitment, replaced at 26,300 miles.	12	3618
24 May 2023	Rear nearside Michelin Agilis CrossClimate · 225/75 R16 CP 118R · Full set of four, fitted at Kwik Fit Leyland.	26,300	0523



YF18 KXN — vehicle record

15 Mar 2018	Rear offside Continental VanContact 4Season · 225/75 R16 CP 118R · removed 24 May 2023 · Original fitment, replaced at 26,300 miles.	12	3618
24 May 2023	Rear offside Michelin Agilis CrossClimate · 225/75 R16 CP 118R · Full set of four, fitted at Kwik Fit Leyland.	26,300	0523
15 Mar 2018	Spare Continental VanContact 4Season · 225/75 R16 CP 118R · Never used. Underslung carrier.	12	3518

DOT codes are reproduced exactly as transcribed from the sidewall. No age or replacement date has been calculated from them.

Damp surveys

Readings by location

	Oct 2020	Sep 2021	Sep 2022	Sep 2023	Sep 2024	Sep 2025	Mar 2026	change
Rear nearside lower corner	18	18	20	23	19	17	17	—
Rear offside lower corner	16	15	16	17	16	15	<10	−1
Nearside wall, rear		16	17	18	16	16	15	−1
Washroom, below window				16	16	15	Not accessible — unit fitted over	−1

Percentages, as recorded. A blank means that location was not read in that survey. The 2 earliest surveys are listed in full below.

28 March 2026

Meter: Brennenstuhl MD (own meter)

Not a professional survey — my own meter, for my own peace of mind.

Checked the rear corner myself before booking this year's service. Reading is holding.

Rear nearside lower corner	17%	Rear offside lower corner	<10
Nearside wall, rear	15%	Washroom, below window	Not accessible — unit fitted over

27 September 2025 · Ribble Valley Motorhomes

Part of the habitation check of 27 September 2025

Scheme reference: AWS/RVM/2025/4088

Meter: Protimeter Aquant

Engineer: T. Nuttall

Four readings above 15%, all lower than last year.

Nearside wall, rear	16%	Rear nearside lower corner	17%
Rear offside lower corner	15%	Washroom, below window	15%

21 September 2024 · Ribble Valley Motorhomes

Part of the habitation check of 21 September 2024

Scheme reference: AWS/RVM/2024/3602

Meter: Protimeter Aquant

Engineer: T. Nuttall

Four readings above 15%. Rear nearside corner down four points on last year.



YF18 KXN — vehicle record

Nearside wall, rear	16%	Rear nearside lower corner	19%
Rear offside lower corner	16%	Washroom, below window	16%

30 September 2023 · Ribble Valley Motorhomes

Part of the habitation check of 30 September 2023

Scheme reference: AWS/RVM/2023/3155

Meter: Protimeter Aquant

Engineer: T. Nuttall

Four readings above 15%. Rear nearside corner at 23% before the reseal carried out at this visit.

Nearside wall, rear	18%	Rear nearside lower corner	23%
Rear offside lower corner	17%	Washroom, below window	16%

24 September 2022 · Ribble Valley Motorhomes

Part of the habitation check of 24 September 2022

Scheme reference: AWS/RVM/2022/2691

Meter: Protimeter Aquant

Engineer: T. Nuttall

Three readings above 15%. Rear nearside corner up two points on last year.

Nearside wall, rear	17%	Rear nearside lower corner	20%
Rear offside lower corner	16%		

18 September 2021 · Ribble Valley Motorhomes

Part of the habitation check of 18 September 2021

Scheme reference: AWS/RVM/2021/2210

Meter: Protimeter Aquant

Engineer: T. Nuttall

Three readings above 15%. Rear nearside unchanged on last year despite reseal.

Nearside wall, rear	16%	Rear nearside lower corner	18%
Rear offside lower corner	15%		

3 October 2020 · Marquis Preston

Part of the habitation check of 3 October 2020

Scheme reference: AWS/MP/2020/5744

Meter: Protimeter Surveymaster

Engineer: S. Kerrigan

Two readings above 15%, both at the rear. Advised resealing the rear light clusters.

Rear nearside lower corner	18%	Rear offside lower corner	16%
----------------------------	-----	---------------------------	-----

26 September 2019 · Marquis Preston

Part of the habitation check of 26 September 2019

Scheme reference: AWS/MP/2019/5108

Meter: Protimeter Surveymaster

Engineer: D. Ashworth

One reading above 15%. All other locations below the reporting threshold.

Rear nearside lower corner	16%
----------------------------	-----

20 September 2018 · Marquis Preston

Part of the habitation check of 20 September 2018

Scheme reference: AWS/MP/2018/4471

Meter: Protimeter Surveymaster

Engineer: D. Ashworth

No readings above 15% recorded anywhere in the vehicle. Report carries no figures.



YF18 KXN — vehicle record

Readings are reproduced exactly as recorded. NomadStamp does not assess or flag these values, and no threshold has been applied to them.

Appliances fitted

Fitted	Appliance	Serial
15 Mar 2018	Heating and hot water Truma Combi 6E	24518803
15 Mar 2018	Fridge Thetford N3142 (absorption) · removed 18 May 2023 · Replaced under warranty — cooling unit failed in Spain.	N3142-77219
18 May 2023	Fridge Thetford N4142 (compressor)	N4142-40881
15 Mar 2018	Hob and grill Thetford Triplex 3-burner	TX3-559210
15 Mar 2018	Toilet Thetford C263-CS cassette	C263-118844
15 Mar 2018	Water pump Whale Watermaster 12V	WM-772104
15 Mar 2018	Space heater blown air Truma Ultraheat 230V	UH-330217
12 Jun 2021	Solar controller Votronic MPP 350 Duo Digital	VOT-9911204
12 Jun 2021	Leisure battery Roamer 110Ah LiFePO4	RM-LI110-3388
2 Apr 2022	Carbon monoxide alarm Fireangel CO-9B	FA-CO-55127

Fitted dates are as recorded. No age or replacement interval has been calculated from them.

Damage

Date	What happened	Repaired	Cost
16 Nov 2025	Stone off a lorry chipped the windscreen, low down on the passenger side. Not in the swept area. A66 near Bowes · Watching it. Insurer says it's a replacement not a repair if it spreads.	No	
3 Jul 2022	Overhanging branch caught the nearside of the roof and cracked the rear rooflight surround. Car park, Aysgarth Falls · Rooflight replaced by Ribble Valley Motorhomes, August 2022.	Yes	£185.00
11 Aug 2019	Reversed into a low stone bollard I couldn't see over the rear. Cracked the offside rear light cluster and scuffed the panel below it. Aire at Honfleur, Normandy · Repaired October 2019 at Marquis. New cluster, panel filled and resprayed.	Yes	£420.00



YF18 KXN — vehicle record

Trips

Dates	Where	Odometer	Covered
1 May 2026 – 8 May 2026	Cotswolds, spring Certificated Site (CS)	44,460	340 mi
5 Sep 2025 – 12 Sep 2025	Snowdonia, September Certificated Location (CL)	41,020	310 mi
6 Jun 2025 – 29 Jun 2025	Loire and Burgundy Aire	40,120	2,020 mi
11 Oct 2024 – 18 Oct 2024	Suffolk coast Club site	35,040	360 mi
12 Jul 2024 – 28 Jul 2024	Isle of Skye Wild camping	33,910	1,510 mi
26 Apr 2024 – 6 May 2024	Wye Valley Certificated Site (CS)	32,090	480 mi
4 Aug 2023 – 6 Sep 2023	Picos de Europa, Spain Aire	29,480	2,380 mi
5 May 2023 – 14 May 2023	Northumberland again Commercial site	26,580	570 mi
2 Sep 2022 – 9 Sep 2022	Anglesey Club site	23,240	350 mi
17 Jun 2022 – 15 Jul 2022	Dordogne and the Lot Aire	22,610	2,210 mi
8 Apr 2022 – 11 Apr 2022	Peak District weekend Certificated Location (CL)	19,690	210 mi
13 Aug 2021 – 31 Aug 2021	North Coast 500 Wild camping	17,050	1,440 mi
11 Jun 2021 – 25 Jun 2021	Cornwall, June Commercial site	15,310	1,090 mi
25 Sep 2020 – 2 Oct 2020	Scottish Borders Wild camping	10,690	710 mi
21 Aug 2020 – 30 Aug 2020	Lake District, half term Certificated Site (CS)	9,640	520 mi
4 Oct 2019 – 7 Oct 2019	Yorkshire Dales, long weekend Certificated Location (CL)	6,520	210 mi
19 Jul 2019 – 9 Aug 2019	Normandy and Brittany Aire	5,960	1,940 mi
10 Aug 2018 – 19 Aug 2018	Northumberland coast Commercial site	2,480	570 mi
25 May 2018 – 3 Jun 2018	Pembrokeshire, Easter Club site	1,190	550 mi



YF18 KXN — vehicle record

6 Apr 2018 – 8 Apr 2018	Shakedown weekend, Ribble Valley Certificated Location (CL)	218	98 mi
-------------------------	--	-----	-------

Odometer readings

Date	Note	Odometer
26 Jul 2026	Reading off the dash this morning.	45,720
12 Jul 2026	Reading	45,390
14 Jun 2026	After the Cotswolds.	44,980
28 Feb 2026	Reading	42,640
31 Jan 2026	Reading	42,310
28 Dec 2025	End of year.	42,100
30 Aug 2025	Reading	40,460
20 Jul 2025	Just before the France trip.	40,010
25 Jan 2025	Reading	36,380
29 Dec 2024	End of year.	36,240
17 Feb 2024	Reading	30,420
6 Jan 2024	New year, before laying it up.	30,180

Recorded as read. Nothing has been interpolated between these readings and no expected mileage has been calculated from them.

Checks carried out

Date	Checklist	Ticked
1 May 2026	Before setting off	12 of 12 ticked
1 May 2026	Arriving on site	8 of 8 ticked
15 Nov 2025	Winterising Left the tyres uncovered — covers have perished.	8 of 9 ticked
6 Jun 2025	Before setting off	12 of 12 ticked
6 Jun 2025	Arriving on site No hook-up on the first aire.	7 of 8 ticked
9 Nov 2024	Winterising First proper winterise since the lithium went in.	9 of 9 ticked
12 Jul 2024	Before setting off Forgot the aerial. Remembered at the end of the drive.	11 of 12 ticked
12 Jul 2024	Arriving on site	8 of 8 ticked
26 Apr 2024	Before setting off	12 of 12 ticked
26 Apr 2024	Arriving on site	8 of 8 ticked



Photographs and documents

INVOICE AG-2606-4471

Autoglass
30 June 2026
£0.00

Repair, 30 Jun 2026 — Invoice

MOT TEST CERTIFICATE

YF18 KXN
16 March 2026
43,580 miles
MOT-2026-912008

MOT, 16 Mar 2026 — Test certificate



Damage, 16 Nov 2025 — Wide

INVOICE FC-2604-1013

Fenwick Commercial, Chorley
22 April 2026
43,910 miles
£428.00

Base vehicle service, 22 Apr 2026 — Invoice

INVOICE RVM-25-2091

Ribble Valley Motorhomes
3 December 2025
£112.00

Habitation service, 3 Dec 2025 — Invoice



Damage, 16 Nov 2025 — Close



Habitation check, 27 Sep 2025 — Certificate

Habitation check, 27 Sep 2025 — Invoice

Ribble Valley Motorhomes
 AHS/RVM/2025/4088
 Four readings above 15%, all lower than last year.
 Nearside wall, rear: 16%
 Rear nearside lower corner: 17%
 Rear offside lower corner: 15%
 Washroom, below window: 15%

Damp survey, 27 Sep 2025 — Damp report

Gas safety record, 18 Sep 2025 — Gas safety record

Base vehicle service, 16 Apr 2025 — Invoice

MOT, 17 Mar 2025 — Test certificate



Safeguard Motorhome
Policy POL-2025-778075
YF18 KXN
Cover from 15 March 2025
Social, domestic, pleasure and commuting.
Class 1 business use included.
European cover 90 days.

Nearside wall, rear: 16%
Rear nearside lower corner: 13%
Rear offside lower corner: 16%
Washroom, below window: 16%

Page 25



Safeguard Motorhome
Policy POL-2024-778072
YF18 KXN
Cover from 15 March 2024
Social, domestic, pleasure and commuting.
Class 1 business use included.
European cover 90 days.

YF18 KXN
11 March 2024
31,120 miles
MOT-2024-856912

Ribble Valley Motorhomes
8 February 2024
£84.50



Ribble Valley Motorhomes
30 September 2023
AWS/RVM/2023/3155
Engineer: T. Nuttall

Ribble Valley Motorhomes
30 September 2023
£442.00

Ribble Valley Motorhomes
 ARS/RV/M/2023/3165

Four readings above 15%. Rear nearside corner at 23% before the reseat carried out at this visit


Nearside wall, rear: 18%
 Rear nearside lower corner: 23%
 Rear offside lower corner: 17%
 Washroom, below window: 16%




Page 27



YF18 KXN — vehicle record

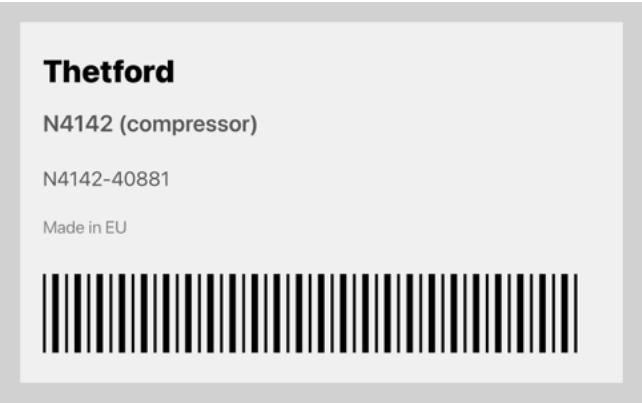

Fridge — Rating label

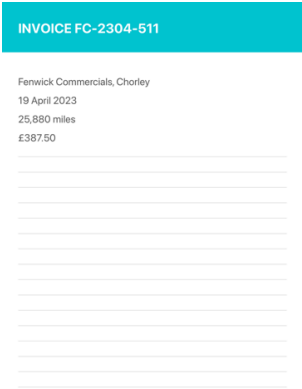

Base vehicle service, 19 Apr 2023 — Invoice



Base vehicle service, 19 Apr 2023 — Workshop sheet



Insurance, 15 Mar 2023 — Schedule



MOT, 13 Mar 2023 — Test certificate



Habitation service, 30 Nov 2022 — Invoice





YF18 KXN — vehicle record

INVOICE FC-2204-338

Ferwick Commercial, Chorley
27 April 2022
19,640 miles
£416.00

Base vehicle service, 27 Apr 2022 — Invoice

Certificate of Motor Insurance

Safeguard Motorhomes
Policy No. 2022-778056
YF18 KXN
Cover from 15 March 2022
Social, domestic, pleasure and commuting.
Class 1 business use included.
European cover 90 days.

Insurance, 15 Mar 2022 — Schedule

HABITATION SERVICE CERTIFICATE

Ribble Valley Motorhomes
18 September 2021
AWS/RVM/2021/Z210
Engineer: T. Nuttall

Habitation check, 18 Sep 2021 — Certificate

Fireangel

CO-9B

FA-CO-55127

Made in EU



Carbon monoxide alarm — Rating label

MOT TEST CERTIFICATE

YF18 KXN
14 March 2022
19,310 miles
MOT-2022-801447

MOT, 14 Mar 2022 — Test certificate

INVOICE RVM-21-0884

Ribble Valley Motorhomes
18 September 2021
£264.00

Habitation check, 18 Sep 2021 — Invoice



Ribble Valley Motorhomes
ANS/RvM/2021/2210

Three readings above 15%. Rear nearside unchanged on last year despite resale

Nearside wall, rear: 16%
Rear nearside lower corner: 18%
Rear offside lower corner: 15%



Page 31



YF18 KXN — vehicle record

Certificate of Motor Insurance

Comfort Insurance
Policy No: 2021-778063
YF18 KXN
Cover from 15 March 2021
Social, domestic, pleasure and commuting.
Class 1 business use included.
European cover 90 days.

Insurance, 15 Mar 2021 — Schedule

HABITATION SERVICE CERTIFICATE

Marquis Preston
3 October 2020
AWS/MP(2020/5744
Engineer: S. Kerrigan

Habitation check, 3 Oct 2020 — Certificate

Damp report — 3 October 2020

Marquis Preston
AWS/MP(2020/5744
Two readings above 10%, both at the rear. Advised re-sealing the rear light clusters.
Rear nearside lower corner: 10%
Rear offside lower corner: 10%

Damp survey, 3 Oct 2020 — Damp report

MOT TEST CERTIFICATE

YF18 KXN
12 March 2021
12,880 miles
MOT-2021-778210

MOT, 12 Mar 2021 — Test certificate

INVOICE MQ-133017

Marquis Preston
3 October 2020
£235.00

Habitation check, 3 Oct 2020 — Invoice

INVOICE MQ-129041

Marquis Preston
21 April 2020
9,980 miles
£312.00

Base vehicle service, 21 Apr 2020 — Invoice



YF18 KXN — vehicle record

Certificate of Motor Insurance

Comfort Insurance
Policy No: 2020-778580
YF18 KXN
Cover from 15 March 2020
Social, domestic, pleasure and commuting.
Class 1 business use included.
European cover 90 days.

Insurance, 15 Mar 2020 — Schedule

HABITATION SERVICE CERTIFICATE

Marquis Preston
26 September 2019
AWS/MP/2019/5108
Engineer: D. Ashworth

Habitation check, 26 Sep 2019 — Certificate

Damp report — 26 September 2019

Marquis Preston
AWS/MP/2019/5108
One reading above 10%. All other locations below the reporting threshold.
Rear nearside lower corner: 10%.

Damp survey, 26 Sep 2019 — Damp report

INVOICE MQ-126718


Marquis Preston
14 October 2019
£420.00

Repair, 14 Oct 2019 — Invoice

INVOICE MQ-124902

Marquis Preston
26 September 2019
£220.00

Habitation check, 26 Sep 2019 — Invoice

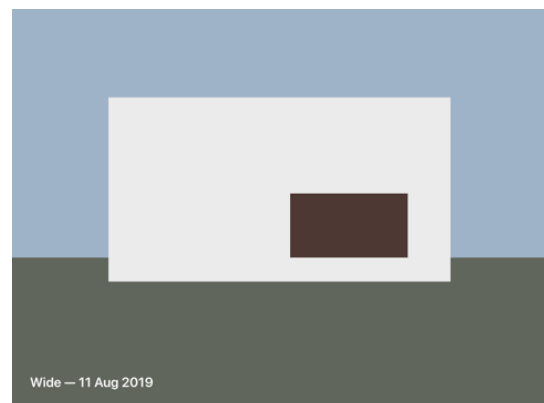

Damage, 11 Aug 2019 — Wide



Comfort Insurance
Policy POL-2019-778957
YF18 K0N
Cover from 15 March 2019
Social, domestic, pleasure and commuting.
Class 1 business use included.
European cover 90 days.

[illegible]

Marquis Preston
9 April 2019
5,240 miles
£284.50

Marquis Preston
20 September 2018
AWS/MP/2018/4471
Engineer: D. Ashworth

Marquis Preston
 AHSJMP/2013/4-471

Page 34




YF18 KXN — vehicle record


Certificate of Motor Insurance

Comfort Insurance
Policy No: 2018-778054
YF18 KXN
Cover from 15 March 2018
Social, domestic, pleasure and commuting.
Class 1 business use included.
European cover 90 days.


Insurance, 15 Mar 2018 — Schedule

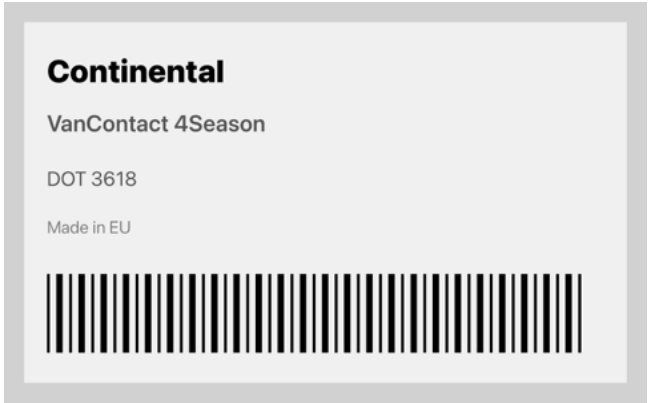


Tyre, Front nearside — Sidewall DOT code

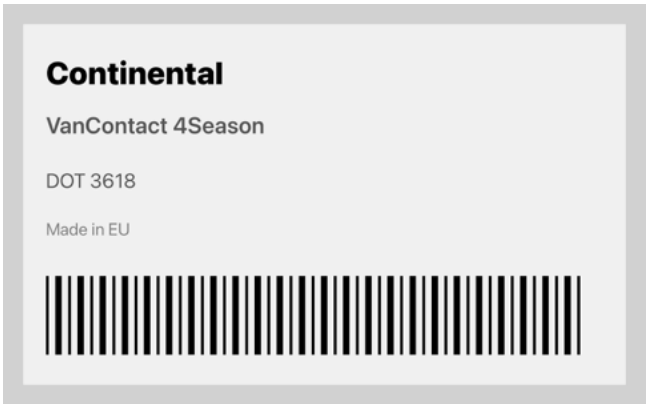


Tyre, Front offside — Sidewall DOT code

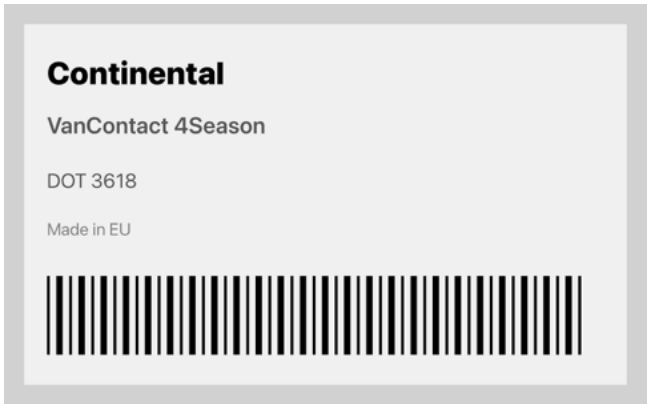

Tyre, Rear nearside — Sidewall DOT code

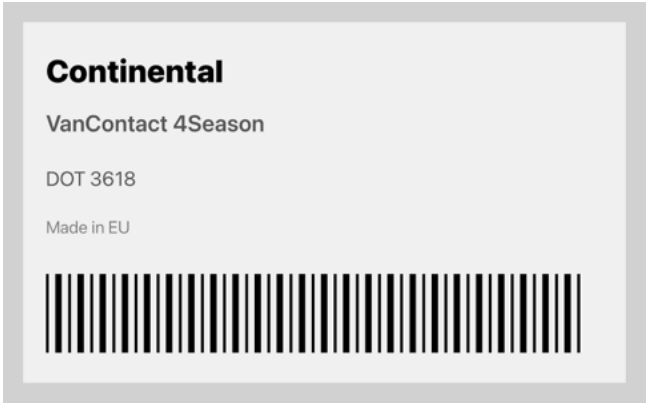

Tyre, Rear offside — Sidewall DOT code

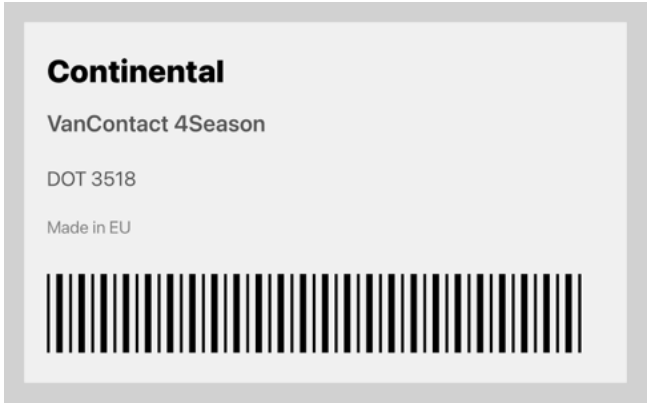

Tyre, Spare — Sidewall DOT code



YF18 KXN — vehicle record

Truma

Combi 6E

24518803

Made in EU



Heating and hot water — Rating label

Thetford

N3142 (absorption)

N3142-77219

Made in EU



Fridge — Rating label

Thetford

Triplex 3-burner

TX3-559210

Made in EU



Hob and grill — Rating label

Thetford

C263-CS cassette

C263-118844

Made in EU



Toilet — Rating label

Whale

Watermaster 12V

WM-772104

Made in EU



Water pump — Rating label

Truma

Ultraheat 230V

UH-330217

Made in EU



Space heater blown air — Rating label

Reproduced from the photographs and files stored against each record. Nothing here has been edited, cropped or enhanced.

Every entry in this document was recorded by the vehicle's owner. NomadStamp stores and prints what it was given; it does not inspect, assess, or verify any of it.